

CAUTION: PROTECT BALLS AND RACES FROM SAWDUST, DIRT, PAINT, ETC. SHOULD BEARING BECOME "ROUGH" FROM DIRTY RACES, FLUSH THOROUGHLY WITH HOT SOAPY WATER, RINSE, OVEN DRY AND RE-OIL.


0.281 [7.14]- 4 HOLES IN PLAIN RACE
 0.281 [7.14]- 4 HOLES IN LOCKING RACE

0.203 [5.16] 4-HOLES IN PLAIN RACE

0.219 [5.56]

THERE WILL BE 2 TO 4 BALLS LEFT OUT DUE TO MANUFACTURING PROCESS.

Ⓞ

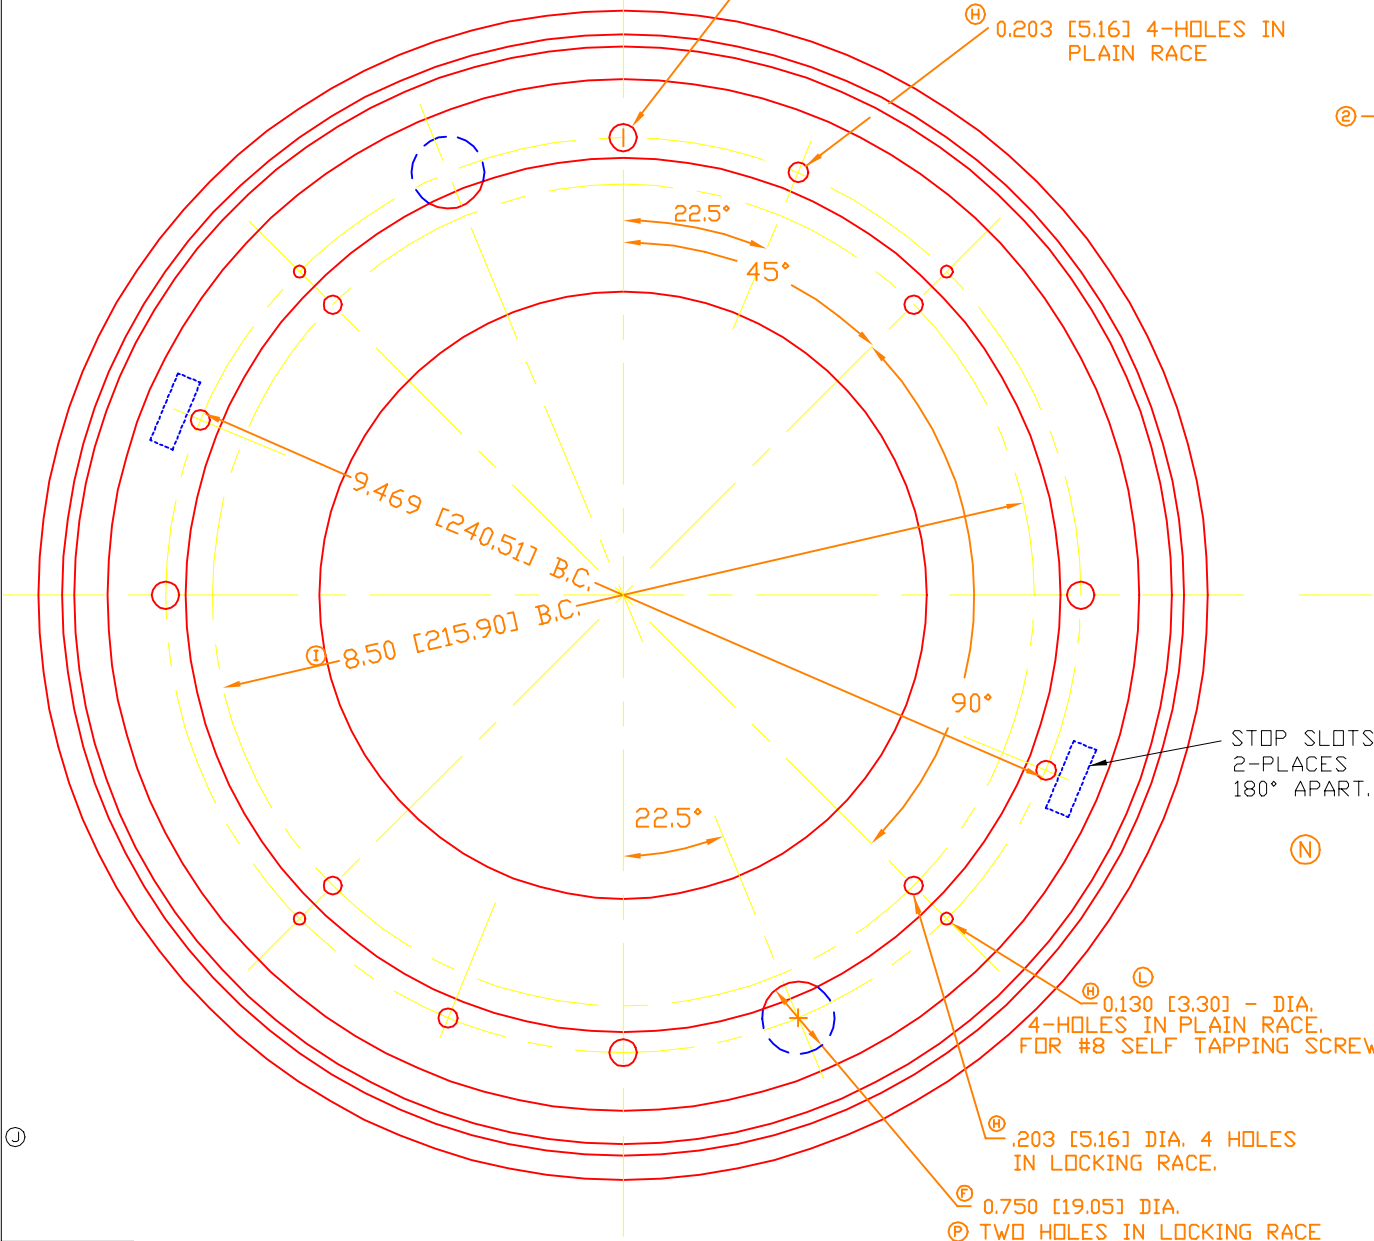

②
③
④

9.047 [229.79]
 REF. Ⓞ
 6.330 [160.78]
 12.063 [306.40]

STOP SLOTS
 2-PLACES
 180° APART.

Ⓝ

PART STAMPED WITH TRIANGLE NAME STAMP

0.130 [3.30] - DIA.
 4-HOLES IN PLAIN RACE,
 FOR #8 SELF TAPPING SCREW

0.203 [5.16] DIA. 4 HOLES IN LOCKING RACE.

0.750 [19.05] DIA.
 TWO HOLES IN LOCKING RACE

0.313 [7.95]


③	3	BALLS12	BALL	1
	2	1866	PLAIN RACE	1
	1	1865	LOCKING RACE	1
DET	PART NUMBER	DESCRIPTION	AMT	
	C TRIANGLE MANUFACTURING CO. OSHKOSH, WI.			

NAME 12" LAZY SUSAN BRG. ASS'Y

FIT	////	USED IN	////
PLATING	ELECTRO GALV	DATE	7-14-76
MATERIAL	SEE DETAIL	DRAWN	LML
ALL DIMS. ±0.03 UNLESS OTHERWISE SPECIFIED	CHECKED	SP	
	SCALE	1 / 1	

9C

CAUTION: PROTECT BALLS AND RACES FROM SAWDUST, DIRT, PAINT, ETC. SHOULD BEARING BECOME "ROUGH" FROM DIRTY RACES, FLUSH THOROUGHLY WITH HOT SOAPY WATER, RINSE, OVEN DRY AND RE-OIL.

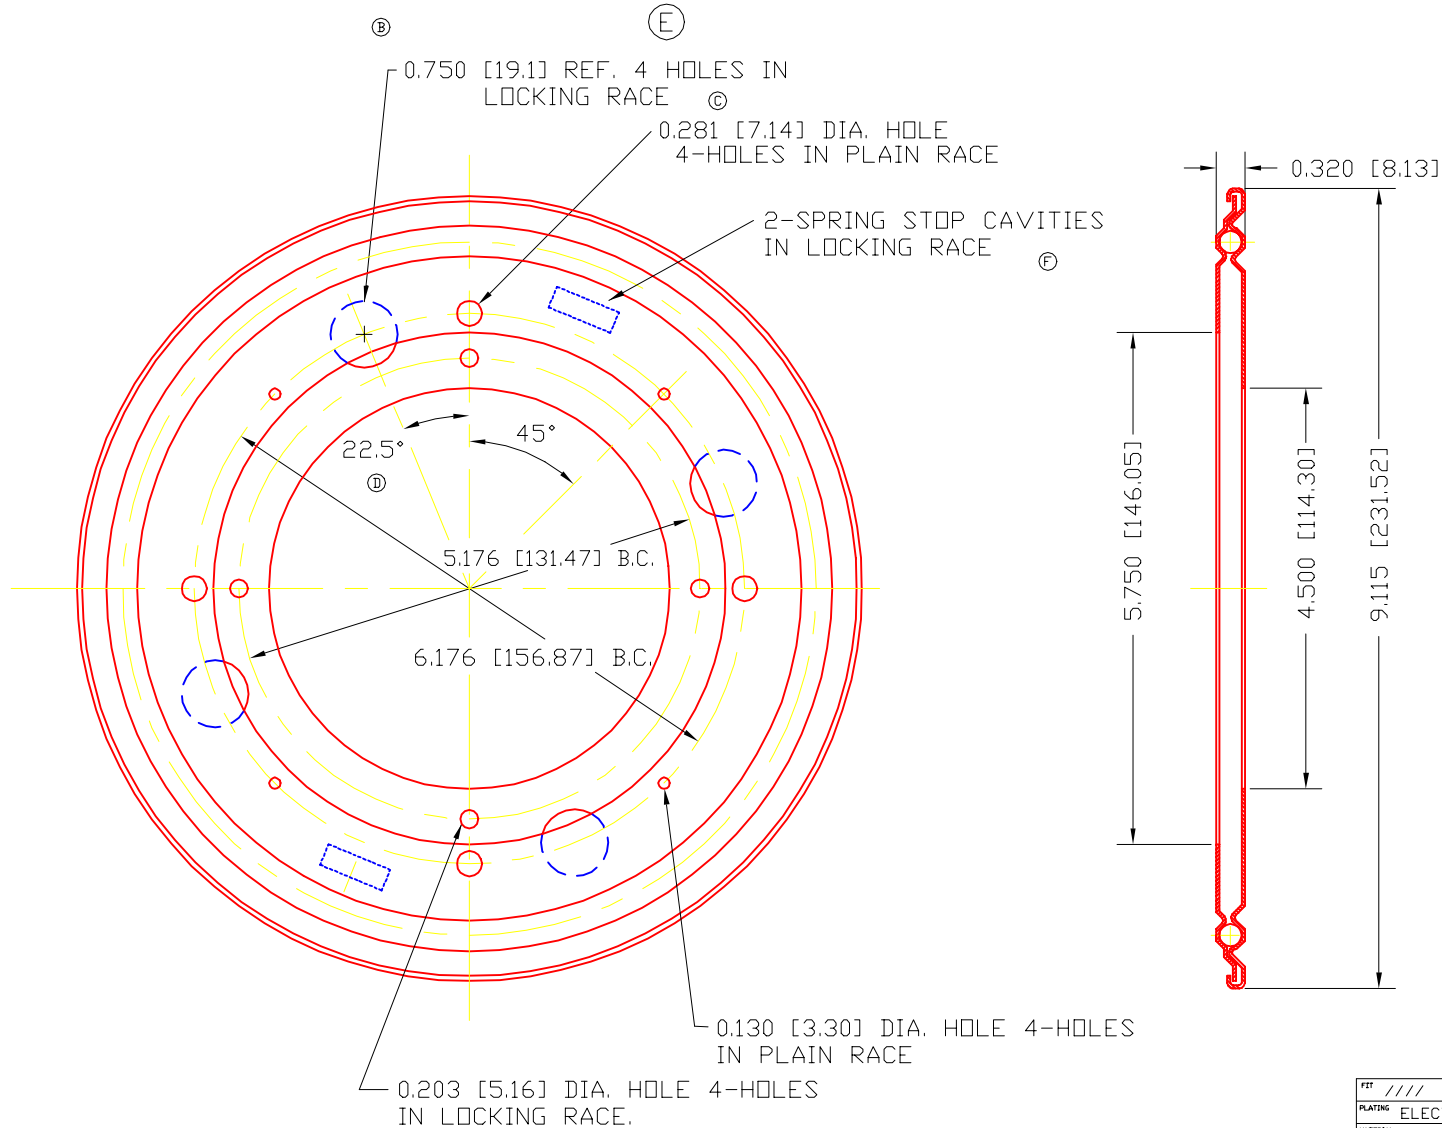

PART STAMPED WITH TRIANGLE NAME STAMP

3	BALLS9	BALL	1
2	7107	PLAIN RACE	1
1	7108	LOCKING RACE	1
DET	PART NUMBER	DESCRIPTION	AMT
C	TRIANGLE MANUFACTURING CO. DSHKOSH, WI.		

NAME		9" LAZY SUSAN BRG. ASS'Y	
USED IN		////	
DATE	01-24-90	PART NO.	
DRAWN	SP		
CHECKED	////		
SCALE	1 / 1		

CHANGE LEVEL
F 108-15-07

FIT ///
PLATING ELECTRO GALV.
MATERIAL SAE DET.
CHECKED ///
SCALE 1 / 1
ALL DIMS ±.020 UNLESS SPECIFIED

9C